UNBLOCKING WASHER JETS



Do not operate the washer jets during adjustment. Windscreen washer fluid may cause irritation to the eyes and skin. Always read and observe the washer fluid manufacturer's instructions.

If a washer jet becomes blocked, use a thin strand of wire to unblock the jet by inserting the wire into the jet. Ensure that the wire is completely removed after unblocking.

LAMP FAILURE

Headlamp unit:



The headlamps are Xenon High Illumination Density (HID) units. Replacement or maintenance of Xenon lamps should only be carried out by qualified personnel.



High voltage is required to ignite the Xenon lamps.



Xenon lamp units operate at a very high temperature. Ensure that the lamp units have cooled before attempting to touch them.



Used Xenon lamp units contain mercury which is hazardous and can be injurious to health.



All other lamps within the headlamp unit are LEDs and should only be replaced by a Dealer/Authorised Repairer.

Correct disposal of the Xenon lamp unit should be referred to your Jaguar Dealer/Authorised Repairer or your local authority.

Side, repeater and rear lamps:



These lamps are LED units and should only be replaced by a Dealer/Authorised Repairer.

LICENSE PLATE LAMP BULB REPLACEMENT




Always replace bulbs with the correct type and specification. If you are in any doubt contact your Dealer/Authorised Repairer for advice.



Before attempting to replace a bulb, ensure that both the affected lamp and the ignition are turned off. Otherwise, damage to the vehicle's electrical system may occur.

License plate lamps each contain a 5 Watt W5W bulb. To replace a bulb:



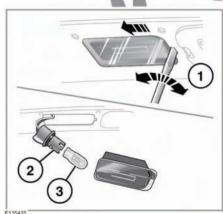

 Insert a small flat-bladed screwdriver into the indent as shown and carefully lever out the side of the lamp unit and remove.