

## UNBLOCKING WASHER JETS



**Do not operate the washer jets during adjustment. Windscreen washer fluid may cause irritation to the eyes and skin. Always read and observe the washer fluid manufacturer's instructions.**

If a washer jet becomes blocked, use a thin strand of wire to unblock the jet by inserting the wire into the jet. Ensure that the wire is completely removed after unblocking.

## LAMP FAILURE

### Headlamp unit:



**The headlamps are Xenon High Illumination Density (HID) units. Replacement or maintenance of Xenon lamps should only be carried out by qualified personnel.**



**High voltage is required to ignite the Xenon lamps.**



**Xenon lamp units operate at a very high temperature. Ensure that the lamp units have cooled before attempting to touch them.**



**Used Xenon lamp units contain mercury which is hazardous and can be injurious to health.**



**All other lamps within the headlamp unit are LEDs and should only be replaced by a Dealer/Authorised Repairer.**

Correct disposal of the Xenon lamp unit should be referred to your Jaguar Dealer/Authorised Repairer or your local authority.

### Side, repeater and rear lamps:



**These lamps are LED units and should only be replaced by a Dealer/Authorised Repairer.**

## LICENSE PLATE LAMP BULB REPLACEMENT





Always replace bulbs with the correct type and specification. If you are in any doubt contact your Dealer/Authorised Repairer for advice.



Before attempting to replace a bulb, ensure that both the affected lamp and the ignition are turned off. Otherwise, damage to the vehicle's electrical system may occur.

License plate lamps each contain a 5 Watt W5W bulb. To replace a bulb:

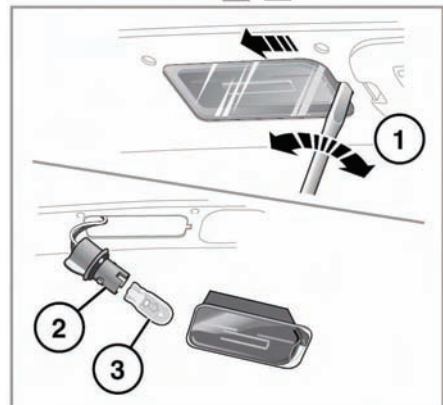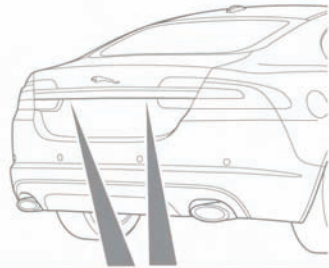

E135415

1. Insert a small flat-bladed screwdriver into the indent as shown and carefully lever out the side of the lamp unit and remove.