

Maintenance

UNBLOCKING WASHER JETS

-  **Do not operate the washer jets during adjustment. Windscreen washer fluid may cause irritation to the eyes and skin. Always read and observe the washer fluid manufacturer's instructions.**

If a washer jet becomes blocked, use a thin strand of wire to unblock the jet by inserting the wire into the jet. Ensure that the wire is completely removed after unblocking.

LAMP FAILURE

Headlamp unit:

-  **The headlamps are Xenon High Illumination Density (HID) units. Replacement or maintenance of Xenon lamps should only be carried out by qualified personnel.**
-  **High voltage is required to ignite the Xenon lamps.**
-  **Xenon lamp units operate at a very high temperature. Ensure that the lamp units have cooled before attempting to touch them.**
-  **Used Xenon lamp units contain mercury which is hazardous and can be injurious to health.**
-  All other lamps within the headlamp unit are LEDs and should only be replaced by a Dealer/Authorised Repairer.

Correct disposal of the Xenon lamp unit should be referred to your Jaguar Dealer/Authorised Repairer or your local authority.


Side, repeater and rear lamps:

-  These lamps are LED units and should only be replaced by a Dealer/Authorised Repairer.

LICENSE PLATE LAMP BULB REPLACEMENT

-  Always replace bulbs with the correct type and specification. If you are in any doubt contact your Dealer/Authorised Repairer for advice.
-  Before attempting to replace a bulb, ensure that both the affected lamp and the ignition are turned off. Otherwise, damage to the vehicle's electrical system may occur.

License plate lamps each contain a 5 Watt W5W bulb. To replace a bulb:

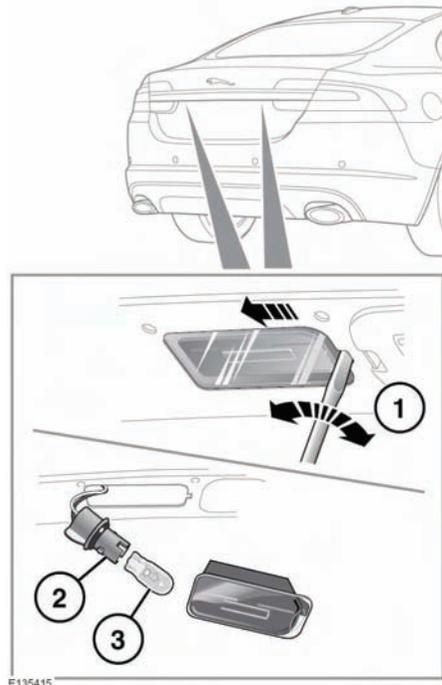

1. Insert a small flat-bladed screwdriver into the indent as shown and carefully lever out the side of the lamp unit and remove.